

Facility: METRO TRUCK AND TRAILER REPAIR / S11850 Inspection Type: Complete Inspection Start Date/Time: 2022-Jul-14 08:10 AM
 Inspector: BAGRI, AMRITPAL / 300086 Inspection Class: Class 3 - Trailer and Semi-Trailer Inspection Complete Date/Time: 2022-Jul-14 09:30 AM
 Work Order Number: 003388 Inspection Reason: Annual

Vehicle Jurisdiction: British Columbia Brake Type: Air Owner/Lessee Name: HAP, HAP TRUCKING LTD.
 Registration Number: 12926425 Fuel Type: Address: 7954 WEBSTER ROAD
 VIN: 1UYVS2536K7730909 Odometer: City: Delta
 Plate Number: 09806J Hub Odometer: Province/State: British Columbia
 Licensed GVW (kg): 0 Body Style: Van Trailer Postal Code/ZIP: V4G 1G6
 Vehicle Year: 2019 Model: Country: Canada
 Make: UTILITY Unit/Fleet Number: 53242

	Result	Comment
Vehicle Identification (VIN)	Passed	
Section 1 - Power Train	Not Applicable	
Section 2 - Suspension	Passed	
Section 3 - Brake System	Passed	
Section 3A - Air Brakes	Repaired (same day)	AXLE 1 LEFT SIDE PIGGYBACK REPLACED
Section 3H - Hydraulic Brakes	Not Applicable	
Section 4 - Steering	Not Applicable	
Section 5 - Instruments and Auxiliary Equipment	Not Applicable	
Section 6 - Lamps	Passed	
Section 7 - Electrical System	Passed	
Section 8 - Frame and Body	Passed	
Section 9A - Tires	Passed	
Section 9B - Wheels	Repaired (same day)	AXLE 2 RIGHT SIDE HUB CAP REPLACED
Section 10 - Coupling Devices	Passed	
Section 11 - Other Vehicle Components	Not Applicable	

Air Brake Chamber Type, Size and Push Rod Stroke Measurements (mm)

Axles (front)	Type	Size	Slack Adj.	Left	Right
1	Clamp	30	Automatic	33	34
2	Clamp	30	Automatic	35	35

Comment:

Tire Tread Depth (mm)

Axles (front)	Outer Left	Inner Left	Inner Right	Outer Right	Steering Axle?
1	13.5	13.5	13.5	13.5	
2	13.5	13.5	13.5	13.5	

Comment:

Air Brake Camshaft Rotation Measurement (degrees)

Axles (front)	Left (degrees)	Right (degrees)
1	45	44
2	45	45

Comment:

Brake Lining/Pad Measurement (mm)

Axles (front)	Lining/Pad	Left	Right
1	Lining (Shoe)	18	18
2	Lining (Shoe)	18	18

Comment:

Rotor Thickness or Drum Inside Diameter Measurement (mm)

Axles (front)	Rotor/Drum	Left	Right
1	Drum	0.00	0.00
2	Drum	0.00	0.00

Comment:


Inspection Comments:

Has this Vehicle been road tested? No When?

Name of the person who did the road test:

Inspector Name: BAGRI, AMRITPAL

Signature: _____

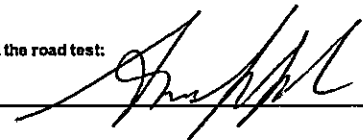

This Inspection Report was submitted to CVSE on 2022-Jul-14 09:33 AM

The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSCMP at the Commercial Vehicle Safety Enforcement

CVSE0014

7/14/2022 10:00:44 AM